

**Software Error Notification****Form 3.5.1****Revision: 2****Effective: 11/21/03****Pg. 1 of 1**

Error Notice Identification Number:   13   Page   1   of   1    
 Software Name:   RADTRAD    
 Versions Affected:   3.03    
 Error Classification:  Safety-Related     Non Safety-Related

**Description of Error:**  
 When running RADTRAD with abrupt flow changes the user can affect dose results by changing the time steps. For example, flow out a PORV is stopped after a few minutes and then that flow is re-directed to a secondary containment. If the time steps are uncontrolled, excessive release from the secondary can occur. This significantly affects the results from TID source terms.

**Assessment of error:**  
 This error has been found to significantly affect dose results in at least one of the rebaselining phase 2 LOCA cases. Thyroid doses were increased by over a factor of 2.  
  
 Note that the error generates more conservative results in all known cases.

Software Program Manager:	<u>  Terry Heames  </u> Printed/Typed Name	_____ Signature	<u>  March 22, 2005  </u> Date
SW Point of Contact:	<u>  Terry Heames  </u> Printed/Typed Name	_____ Signature	<u>  March 22, 2005  </u> Date

**Corrective Action:**  
 If a user has a scenario where flow is redirected after some time they should included user controlled steps of 0.025 hrs until the switch has been completed. The necessary modifications will be included in the next update of Version 3.03 and has been corrected in Version 3.10.

Verified Complete: \_\_\_\_\_  
 QA Manager

Software Program Manager:	<u>  Terry Heames  </u> Printed/Typed Name	_____ Signature	<u>  March 22, 2005  </u> Date
SW Point of Contact:	<u>  Terry Heames  </u> Printed/Typed Name	_____ Signature	<u>  March 22, 2005  </u> Date